


# Load Test Result (MCS Chart)

Site Name \_\_\_\_\_  
 Site Code \_\_\_\_\_  
 Province \_\_\_\_\_

Test Date 22/07/2015 11:17:17  
 Test Time 35:17:10 / 53:00:00  
 MCS NO. \_\_\_\_\_

|       |          |       |    |    |     |       |    |               |  |      |  |             |      |               |  |
|-------|----------|-------|----|----|-----|-------|----|---------------|--|------|--|-------------|------|---------------|--|
| Brand | Hoppecke | Volt. | 48 | Ah | 775 | Cells | 24 | Standby Volt. |  | Type |  | Year/Manuf. | 2008 | Ambient Temp. |  |
|-------|----------|-------|----|----|-----|-------|----|---------------|--|------|--|-------------|------|---------------|--|

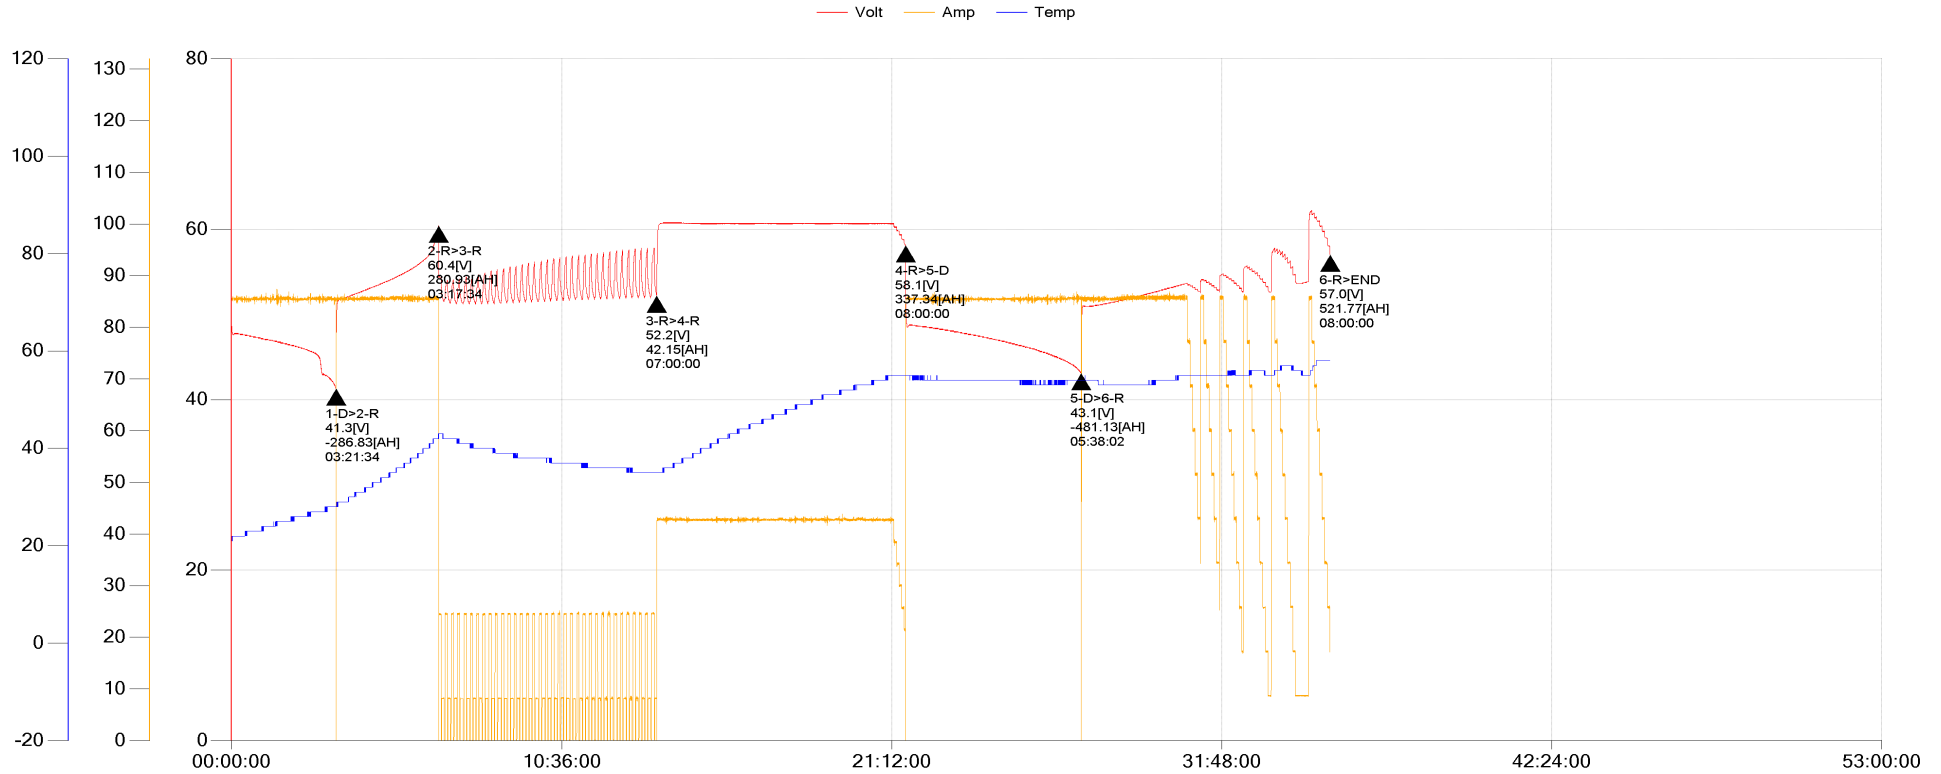

| Index | Method      | Pulse | Setup Time | Elapsed Time | Setup Volt | Max Volt | Min Volt | Setup Amp | AH     | Temperature |
|-------|-------------|-------|------------|--------------|------------|----------|----------|-----------|--------|-------------|
| 1     | Discharge   | 1     | 12:00:00   | 03:21:34     | 41.3       | 51.7     | 41.3     | 85.3      | -286.8 | + 28        |
| 2     | Restoration | 1     | 06:00:00   | 03:17:34     | 60.4       | 60.4     | 44.5     | 85.3      | 280.9  | + 43        |
| 3     | Restoration | 4     | 07:00:00   | 07:00:00     | 62.4       | 57.8     | 51.2     | 24.4      | 42.2   | + 35        |
| 4     | Restoration | 2     | 08:00:00   | 08:00:00     | 62.4       | 60.8     | 52.4     | 42.6      | 337.3  | + 55        |
| 5     | Discharge   | 1     | 12:00:00   | 05:38:02     | 43.1       | 56.5     | 43.1     | 85.3      | -481.1 | + 54        |
| 6     | Restoration | 2     | 08:00:00   | 08:00:00     | 62.4       | 62.2     | 46.1     | 85.3      | 521.8  | + 58        |

35:17:10

